

平陆县 100MW 农光互补光伏发电项目

监理工程师通知单

编号: ZHJL-JLTZ-PL-071


致: 上海电力安装第一工程有限公司 (总包单位)

抄送: 平陆上电万坤新能源有限公司 (业主单位)

主题: 关于监理、总包对东郑光伏场区初验收检查发现以下需要消缺项:

整改内容: 见下图

1

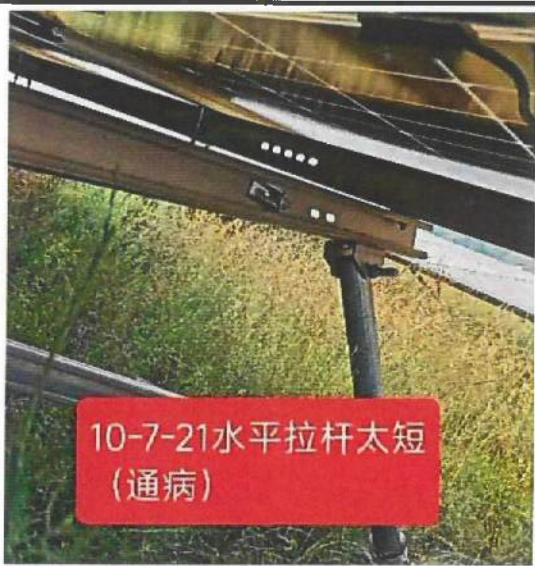


2





3



4

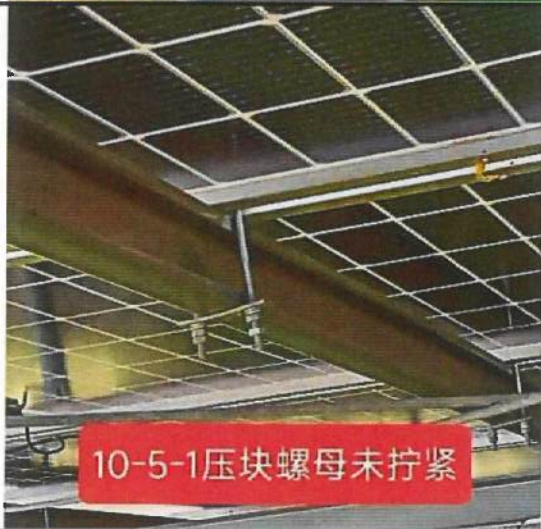

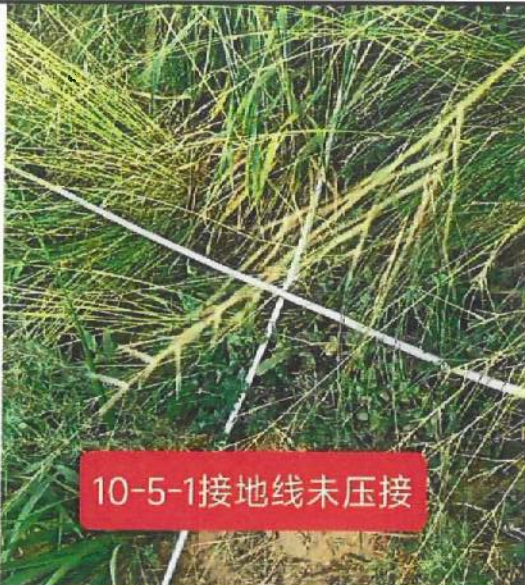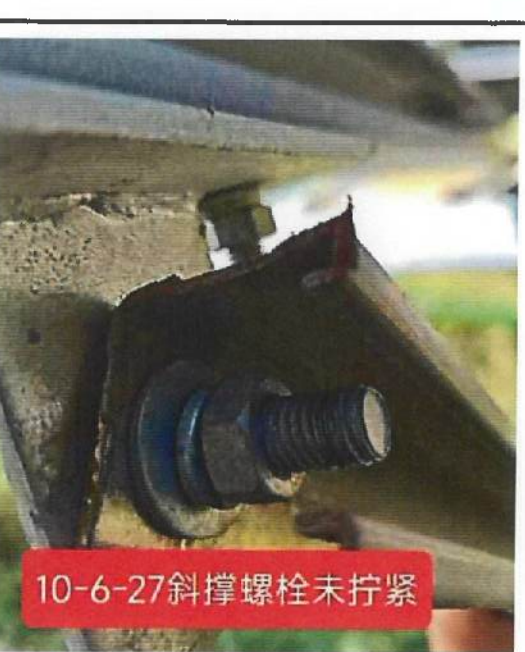5	 10-5-1接地线未压接	6	 10-5-1压块缺少螺母
7	 10-7-10拉杆未拧紧 (通病)	8	 10-6-27组件下沉
9	 10-6-27斜撑螺栓未拧紧	10	 10-6-27组件下有小树苗需清理 (通病)

11



10-6-27斜撑螺栓未拧紧

12




10-6-27组件下有小树苗
需清理 (通病)

13



10-6-26压块缺少螺母

14

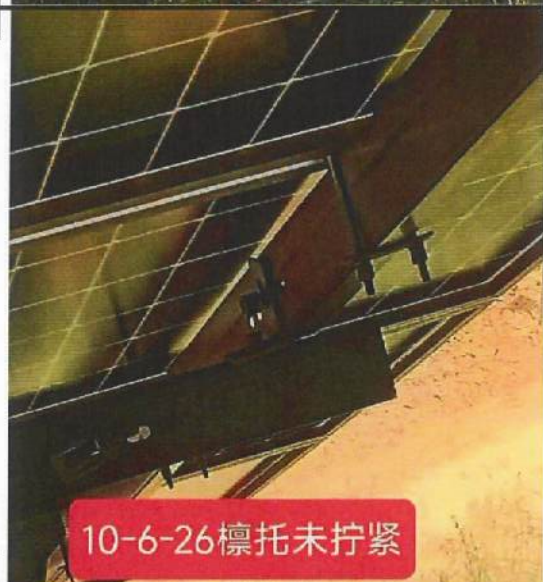

10-6-26檩托未拧紧

15




10-6-26檩托缺少平垫
(通病)

16



10-6-26檩托螺栓未拧紧

17

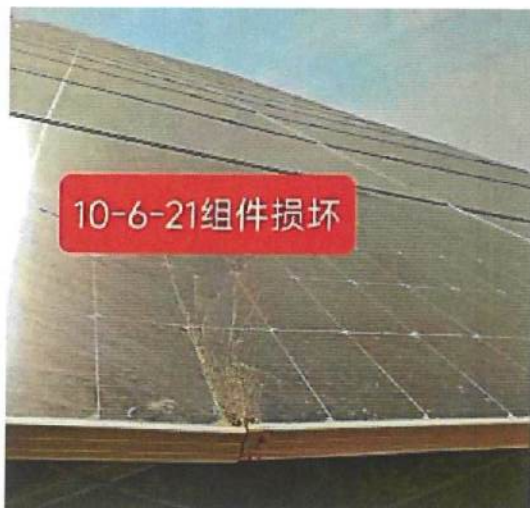

18



19



20








21






22

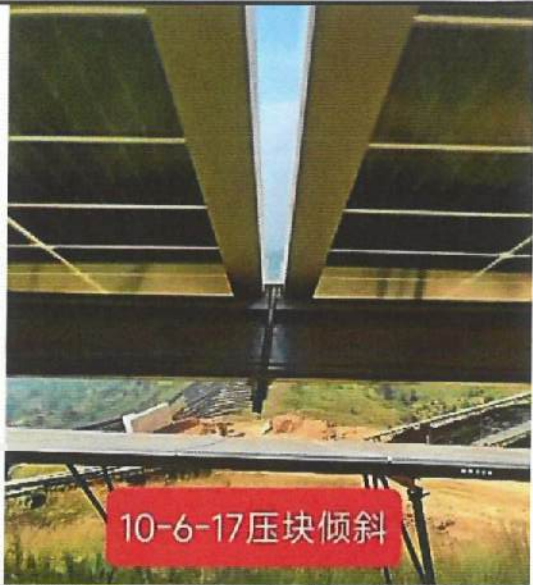

23	 10-6-17压块倾斜	24	 10-6-14檩条连接件缺少螺母
25	 10-6-12压块螺母未拧紧	26	 10-6-12檩托未拧紧
27	 10-6-12缺少斜撑	28	 10-6-9檩条连接件缺少弹垫

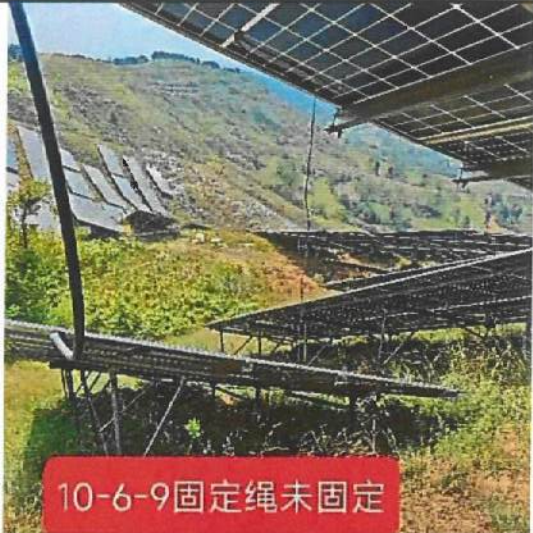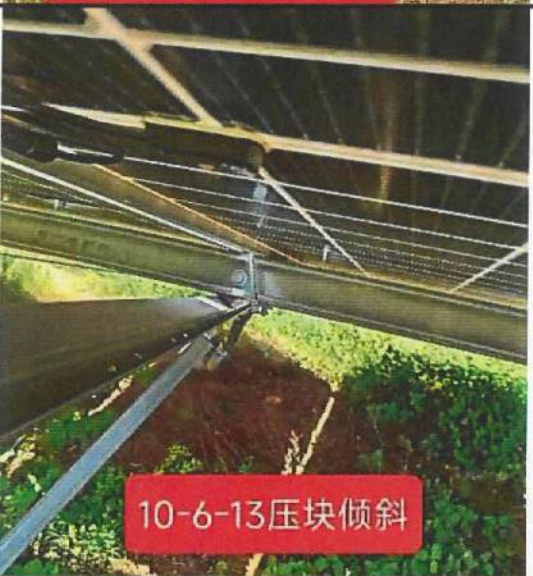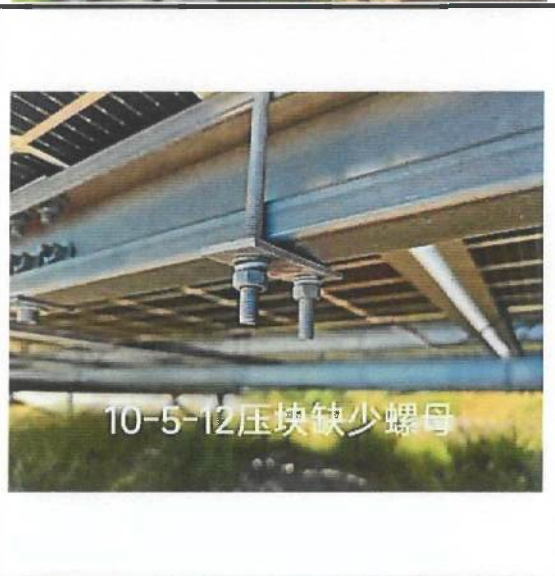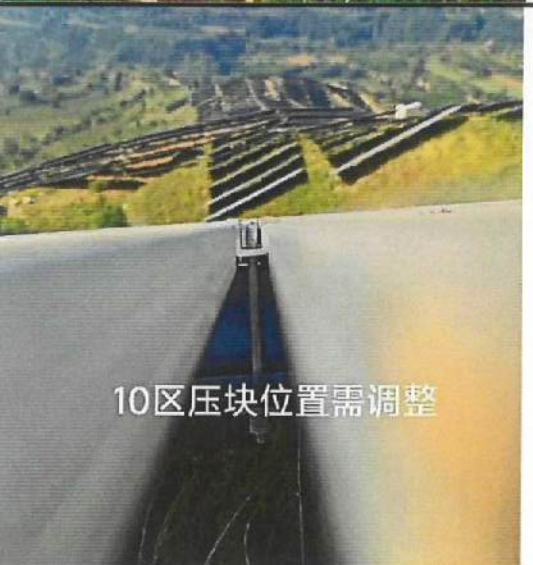
29	 10-6-9固定绳未固定	30	 10-6-13压块缺少垫片
31	 10-6-13压块倾斜	32	 10-5-12压块缺少螺母
33	 10区压块位置需调整	34	 10区地锚桩未浇筑

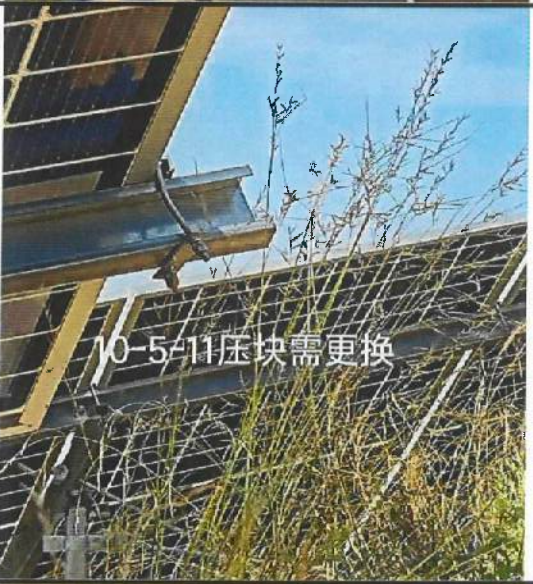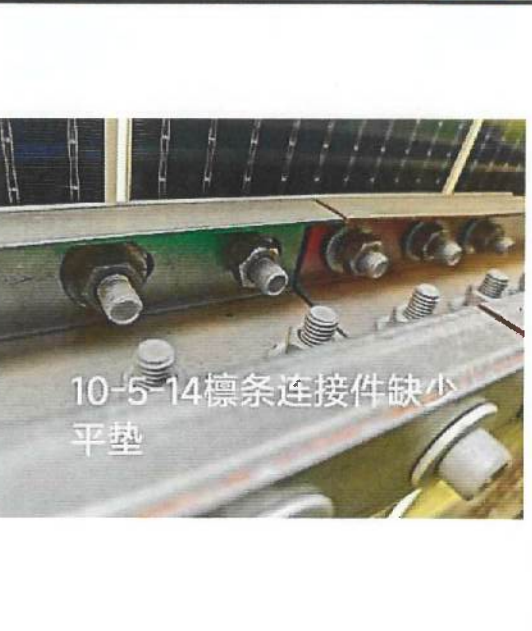35	 10区檩条切孔，需更换檩条	36	 10-5-11压块缺少螺栓
37	 10-5-11压块需更换	38	 10-5-13垫片安装位置错误
39	 10-5-13立柱铰连接缺少平垫	40	 10-5-14檩条连接件缺少平垫

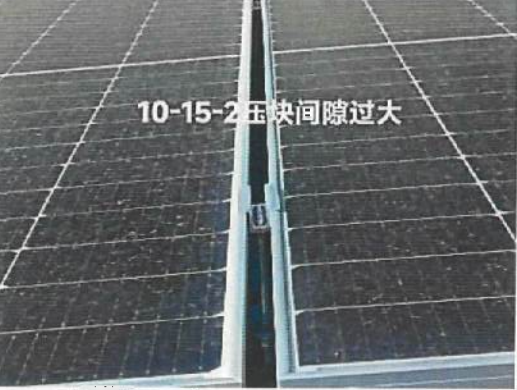41	 10-5-14压块螺栓缺少弹垫	42	 10-5-12檩托螺栓缺少垫片
43	 编号签过高看不见 拉杆螺丝未拧紧	44	 10-15-2 拉杆螺丝未拧紧
45	 10-15-2压块间隙过大	46	 10-15-2斜撑未受力

47	 10-6-28对穿未拧紧	48	 10-6-20斜撑螺丝未拧紧
49	 10-6-17檩托螺丝没拧紧	50	 10-6-17抱箍未紧
51	 10-06-04整组对穿未打	52	 10-06-04缺少平垫

53

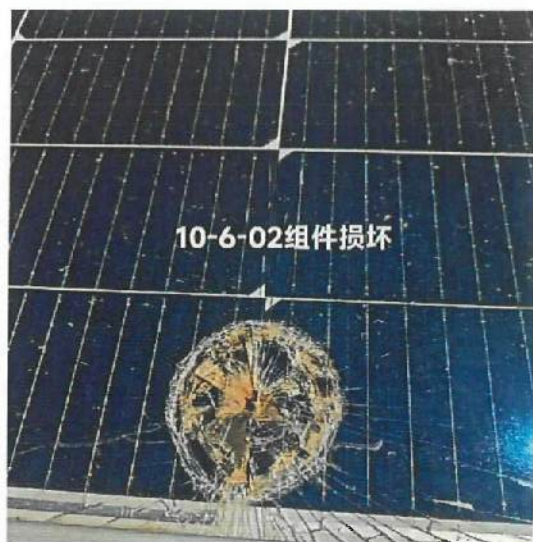

54




55



56





57

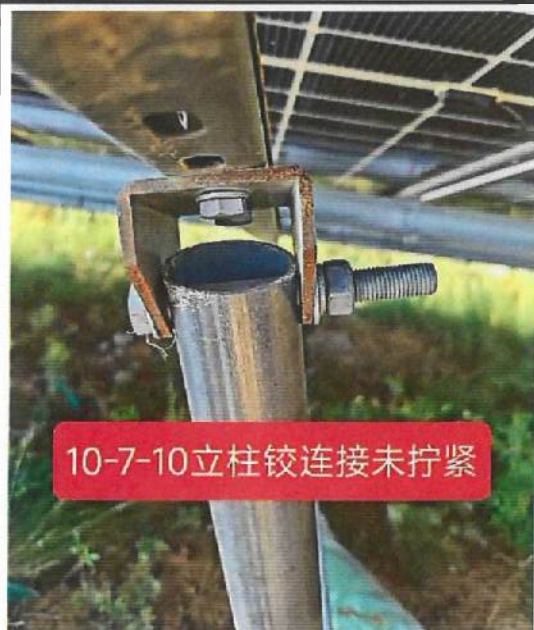

58

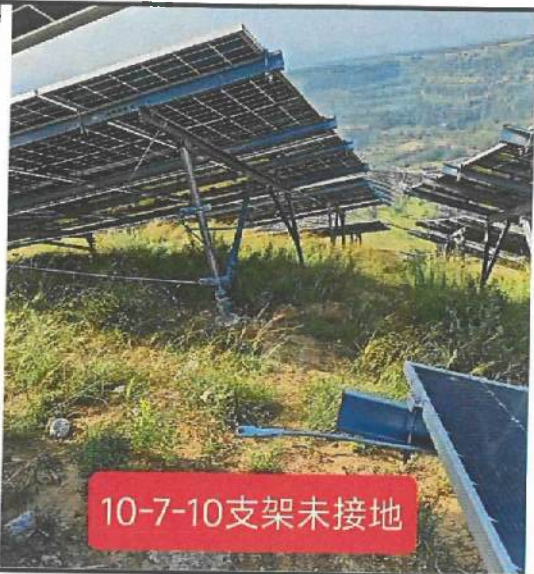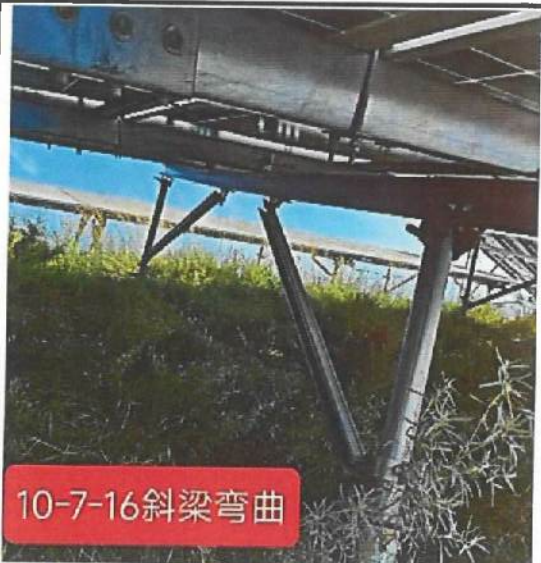

59	 10-7-10支架未接地	60	 10-7-16斜梁弯曲
61		62	

请贵单位按照上述问题立即消缺整改。
 请贵单位在收到本通知后进行立即整改，限 2个 工作日内将整改结果书面回复我方。

项目监理单位（章）：
 专业监理工程师：王春海
 总监理工程师：周林
 日期：2024.05.21

填报说明：本表一式 2 份，由项目监理单位填写，抄送相关单位。