

平陆县 100MW 农光互补光伏发电项目

监理工程师通知单

编号: ZHJL-JLTZ-PL-153



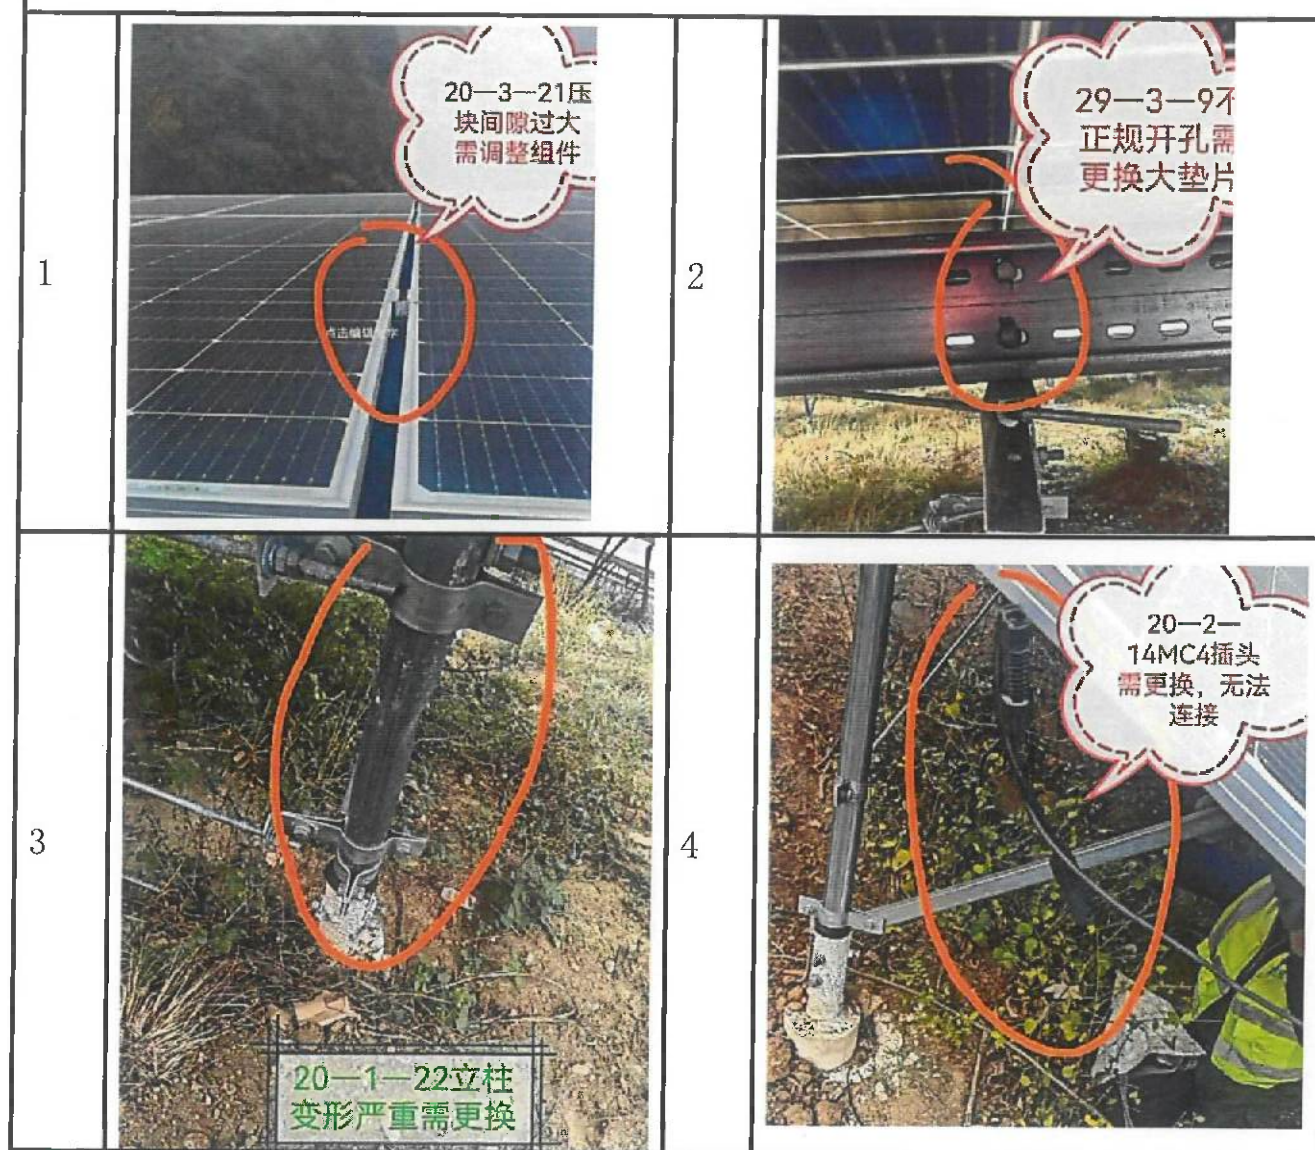
致: 上海电力安装第一工程有限公司 (总包单位)

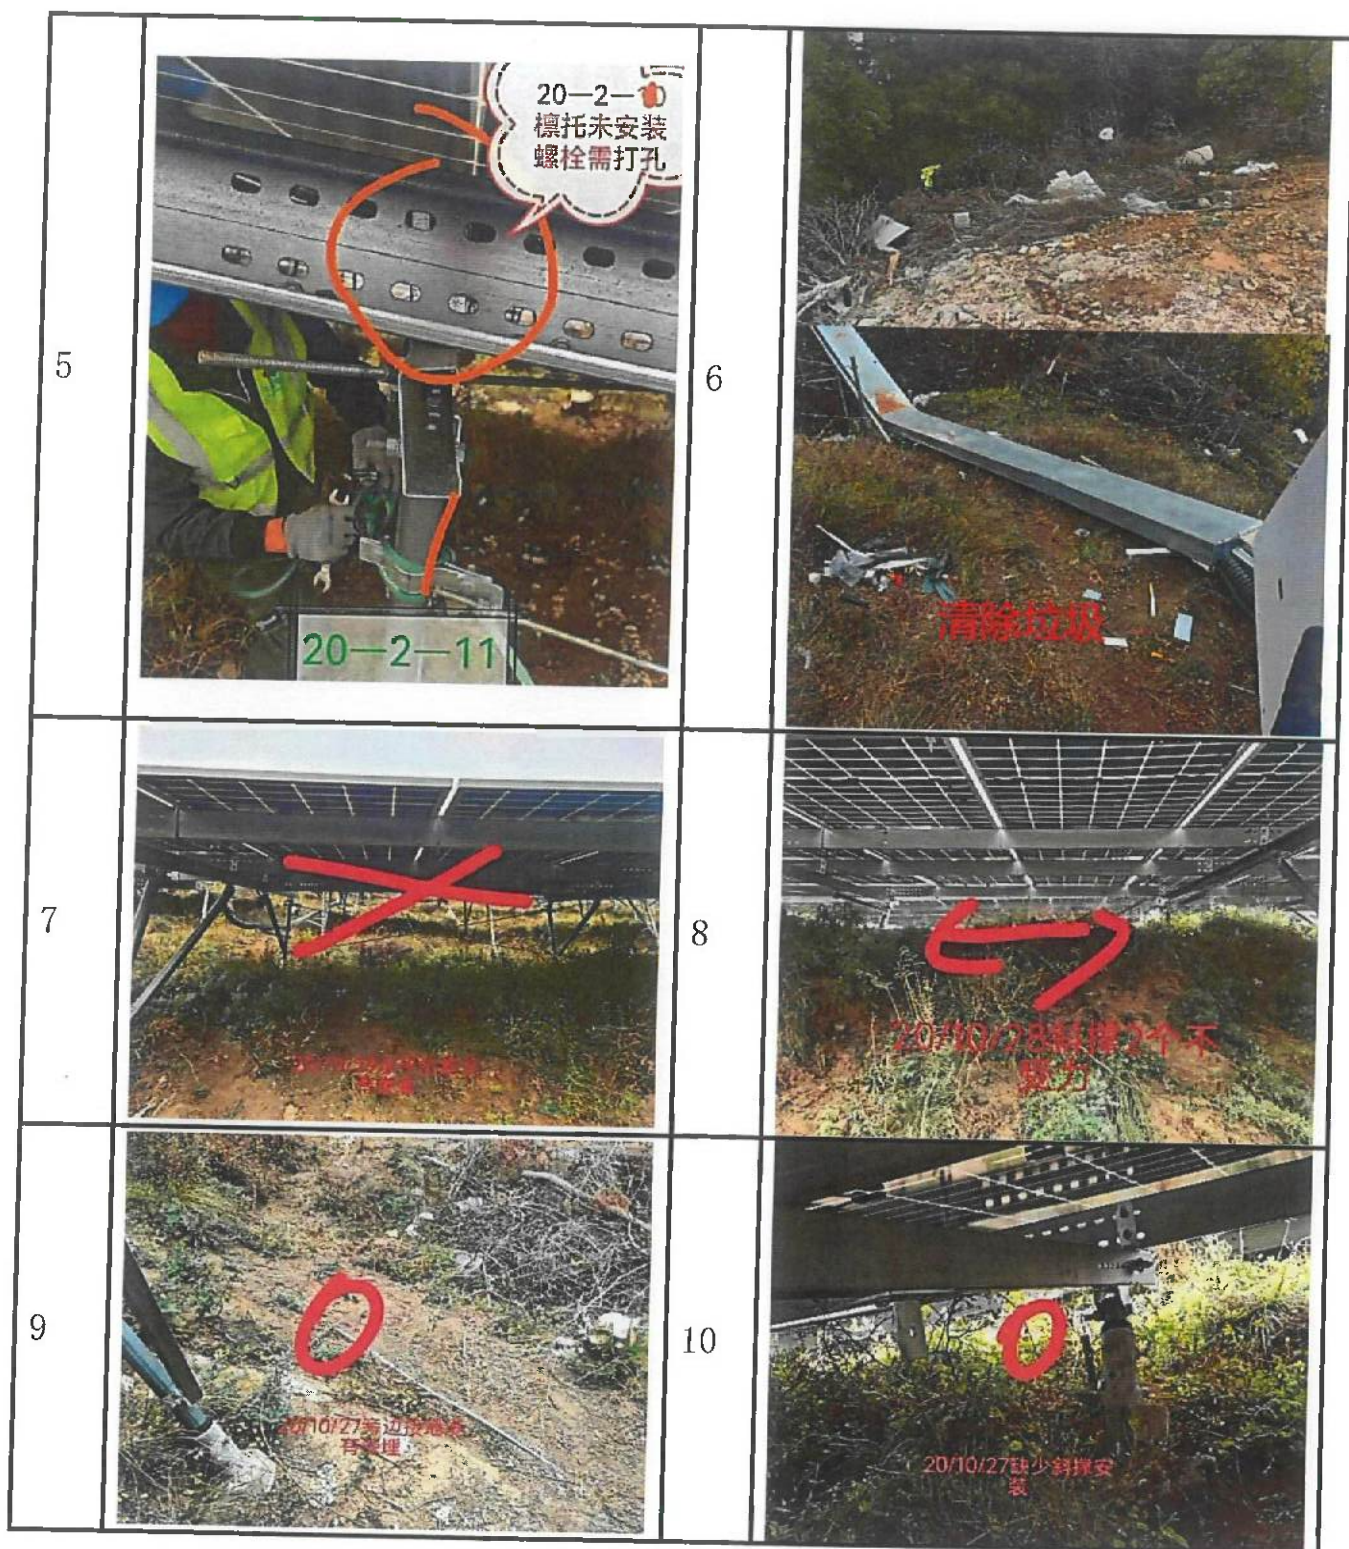
抄送: 平陆上电万坤新能源有限公司 (业主单位)

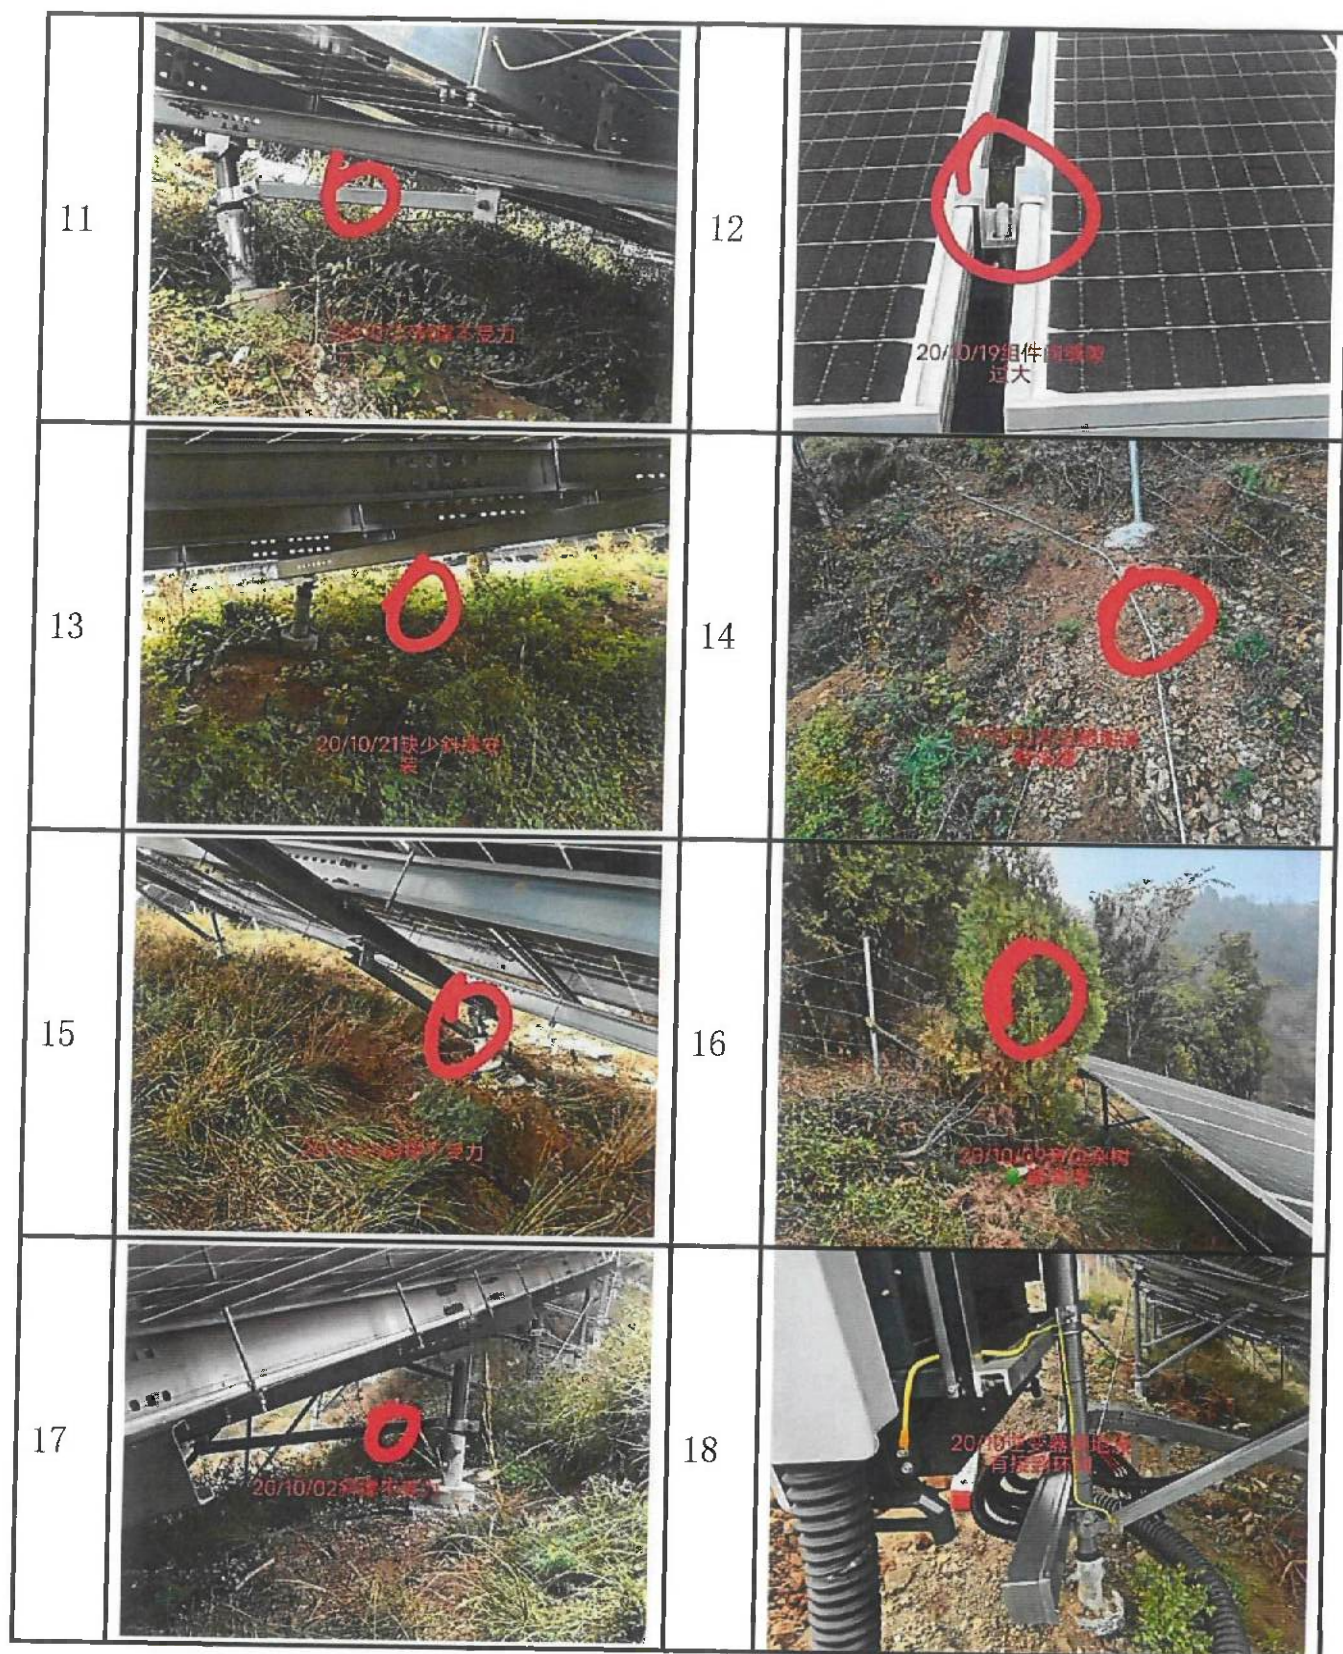
主题:

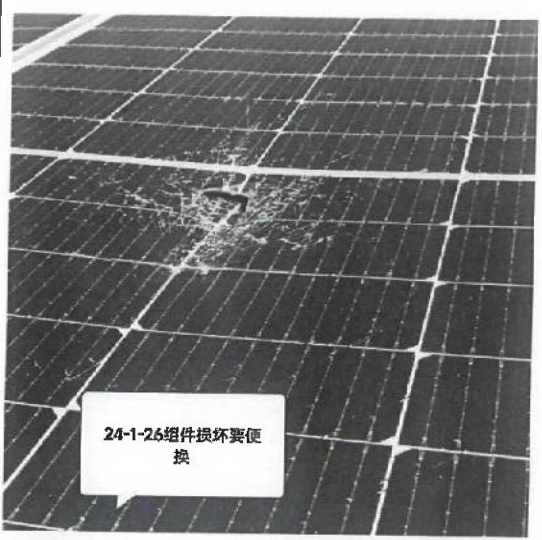
2024年11月11日、12日建设单位、监理单位及总包单位对上苏20、24、28区光伏区验收过程中发现以下问题:

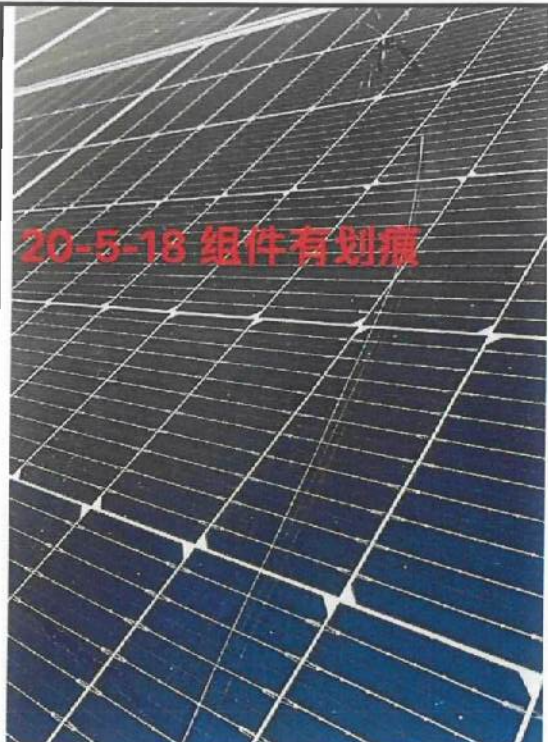
整改内容: 见下图





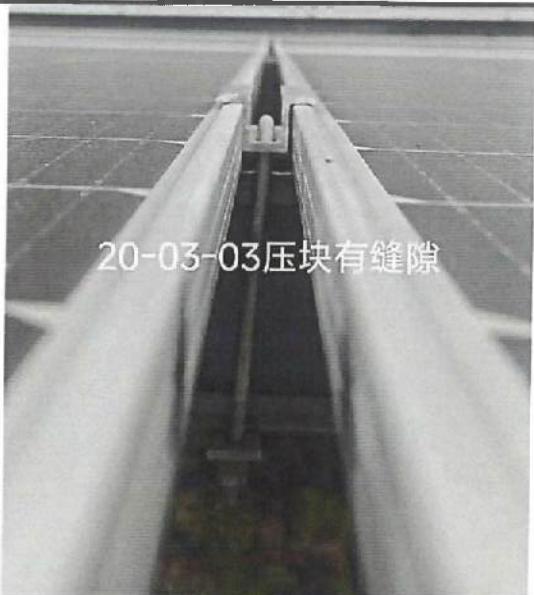


19	 24-1-26组件损坏要便换	20	 24-1-10缺少对穿螺栓
21	 24-1-16对穿螺栓未紧	22	 24-1-6缺少螺栓
23	 24-1-4斜撑不受力	24	 20-5-20附近树枝遮挡

25		26	
27		28	
29		30	

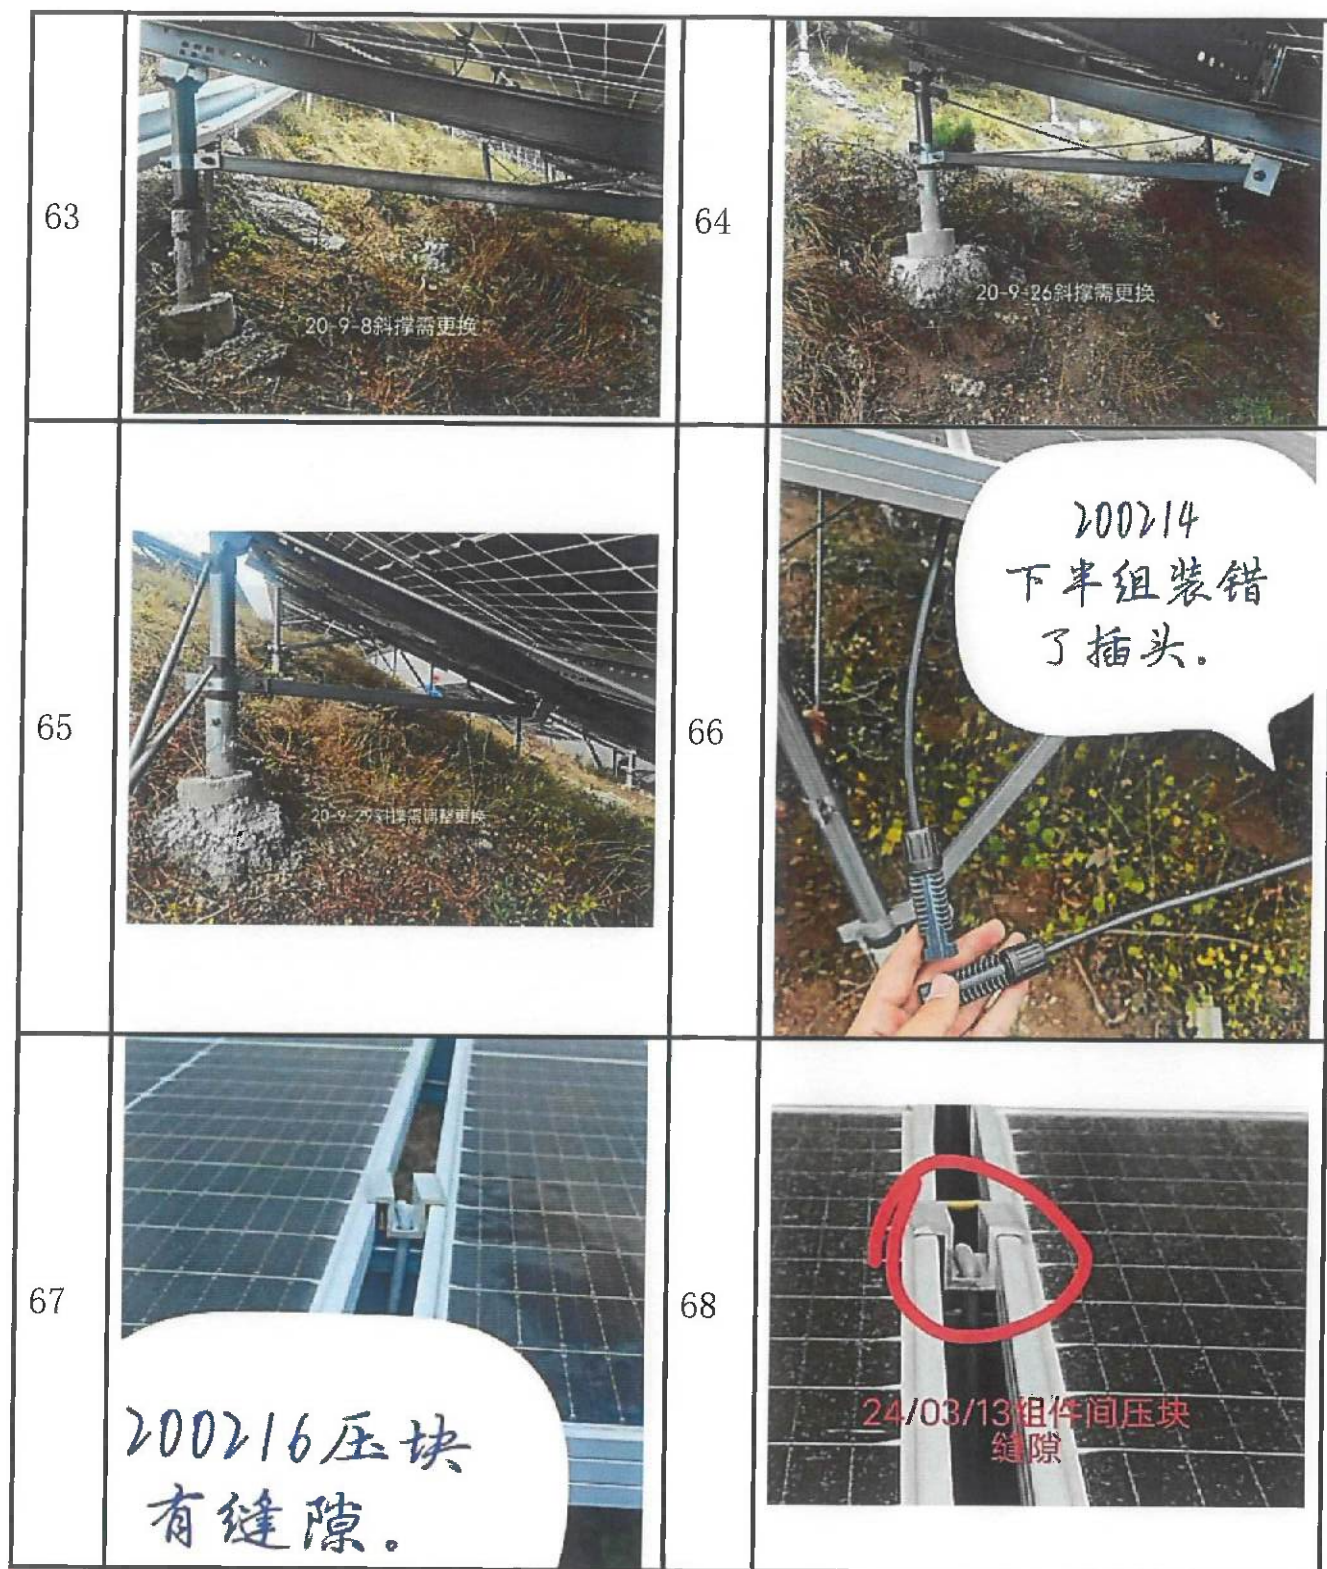
31	 20-01-15压块有缝隙	32	 20-01-16斜撑角度不够
33	 20-01-16对穿螺栓缺少弹垫	34	 20-01-16立柱损坏
35	 20-01-17对穿螺栓安装不合格	36	 20-01-18斜撑角度不够

37	 20-01-19斜撑角度不够	38	 20-02-04压块有缝隙
39	 20-02-03斜撑角度不够	40	 20-02-02斜梁弯曲
41	 20-02-01斜撑角度不够	42	 20-02-01压块有缝隙

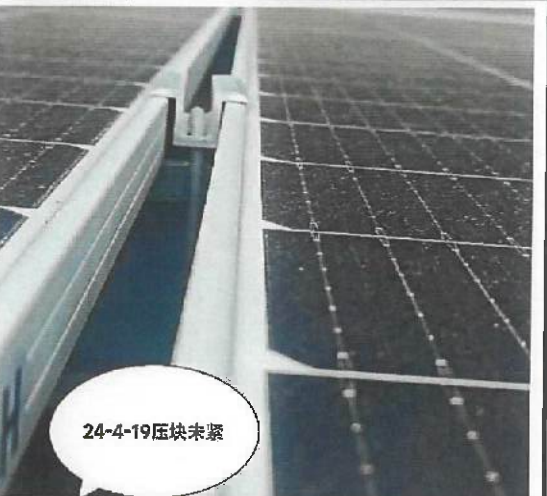
43	 20-03-03压块有缝隙	44	 20-03-03对穿螺栓安装不合格
45	 20-03-16压块有缝隙	46	 20-02-19压块有缝隙
47	 20-04-05接地未埋	48	 20-04-03对穿螺栓安装不合格

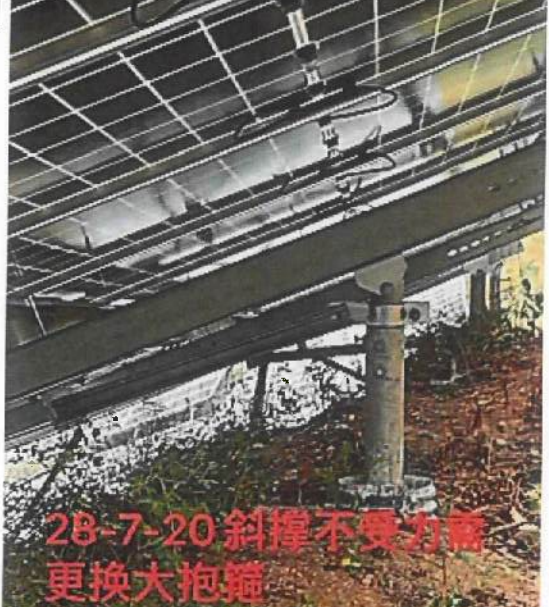
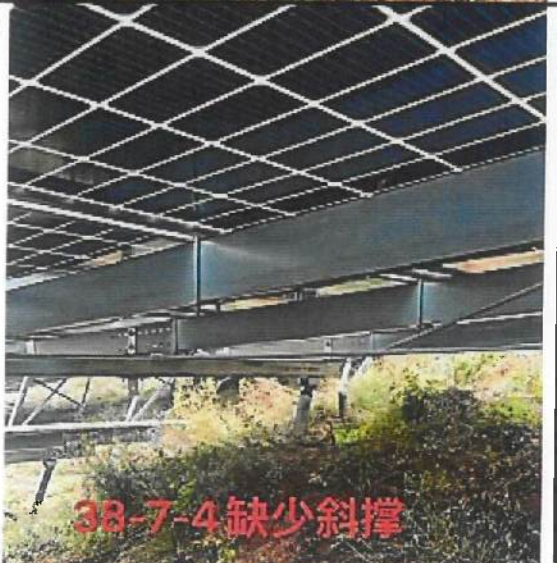
49	 20-8-16支 撑杆	50	 20-8-27支 撑杆
51	 20-08-25 支撑杆	52	 20-8-17支 撑杆
53	 20-8-15支 撑杆	54	 20-9逆变器外壳未直接接地

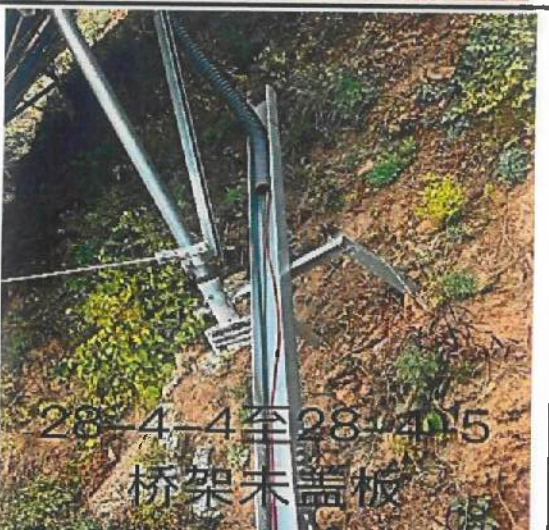
55	 20-9-7上排斜撑杆+螺母副需更换	56	 20-9-2两根斜撑需更换
57	 20-9-8两根斜撑需更换	58	 20-9-10相串3根斜撑需更换
59	 20-9-18斜撑需更换	60	 20-9-19斜撑需调整更换
61	 20-9-23U型卡需更换	62	 20-9-25下斜撑需更换



69	 24/03/06组件与地 面接触	70	 24/02/18斜撑不受力
71	 24/02/19已松脱不 受力要移到前支柱上	72	 24/02/14斜撑不受力 2个
73	 24/02/14对穿螺杆 有上	74	 24/03发现接地线 有连接回路
75	 24/03/13发现不 受力	76	 24/04/02拉筋连接 卡扣生锈

77		78	 24-4-4斜撑不受力
79	 24-4-21环网接地要深埋	80	 24-4-19压块未紧
81	 24-2-6铁对穿螺丝	82	 28-06-09斜撑角度不够

83	 28-06-21斜撑角度不够	84	 28-7-18缺少斜撑
85	 28-7-19缺少斜撑	86	 28-7-20斜撑不受力需 更换大抱箍
87	 28-8-25接地线断了	88	 38-7-4缺少斜撑

89	 接地线未埋	90	 28-5-17缺少斜撑
91	 28-5-15缺少对穿	92	 28方阵4号逆变器区域多处接地未地埋
93	 28方阵4号逆变器区域多处接地未地埋	94	 28-4-4至28-4-5桥架未盖板
95	 28-02逆变器外壳没有直接接地	96	 28-02-06旁边的组件没有找见号码管

97		98	
99		100	

请贵单位按照上述问题立即消缺整改。

请贵单位在收到本通知后进行立即整改，限 3个 工作日内将整改结果书面回复监理项目部。

项目监理机构（章）：

专业监理工程师： 平江县100MWp

总监理工程师： 农光互补光伏发电项目

日 期： 2024.11.12

填报说明：本表一式 2 份，由项目监理机构填写，抄送相关单位。