

平陆县 100MW 农光互补光伏发电项目

监理工程师通知单

编号: ZHJL-JLTZ-PL-141

致: 上海电力安装第一工程有限公司 (总包单位)


抄送: 平陆上电万坤新能源有限公司 (业主单位)





主题:


2024 年 10 月 14、10 月 15 日、10 月 16 日建设单位、监理单位及总包单位对东郑 16、15、14 区光伏区验收过程中发现以下问题:

整改内容: 见下图

1		2	
3		4	
5		6	

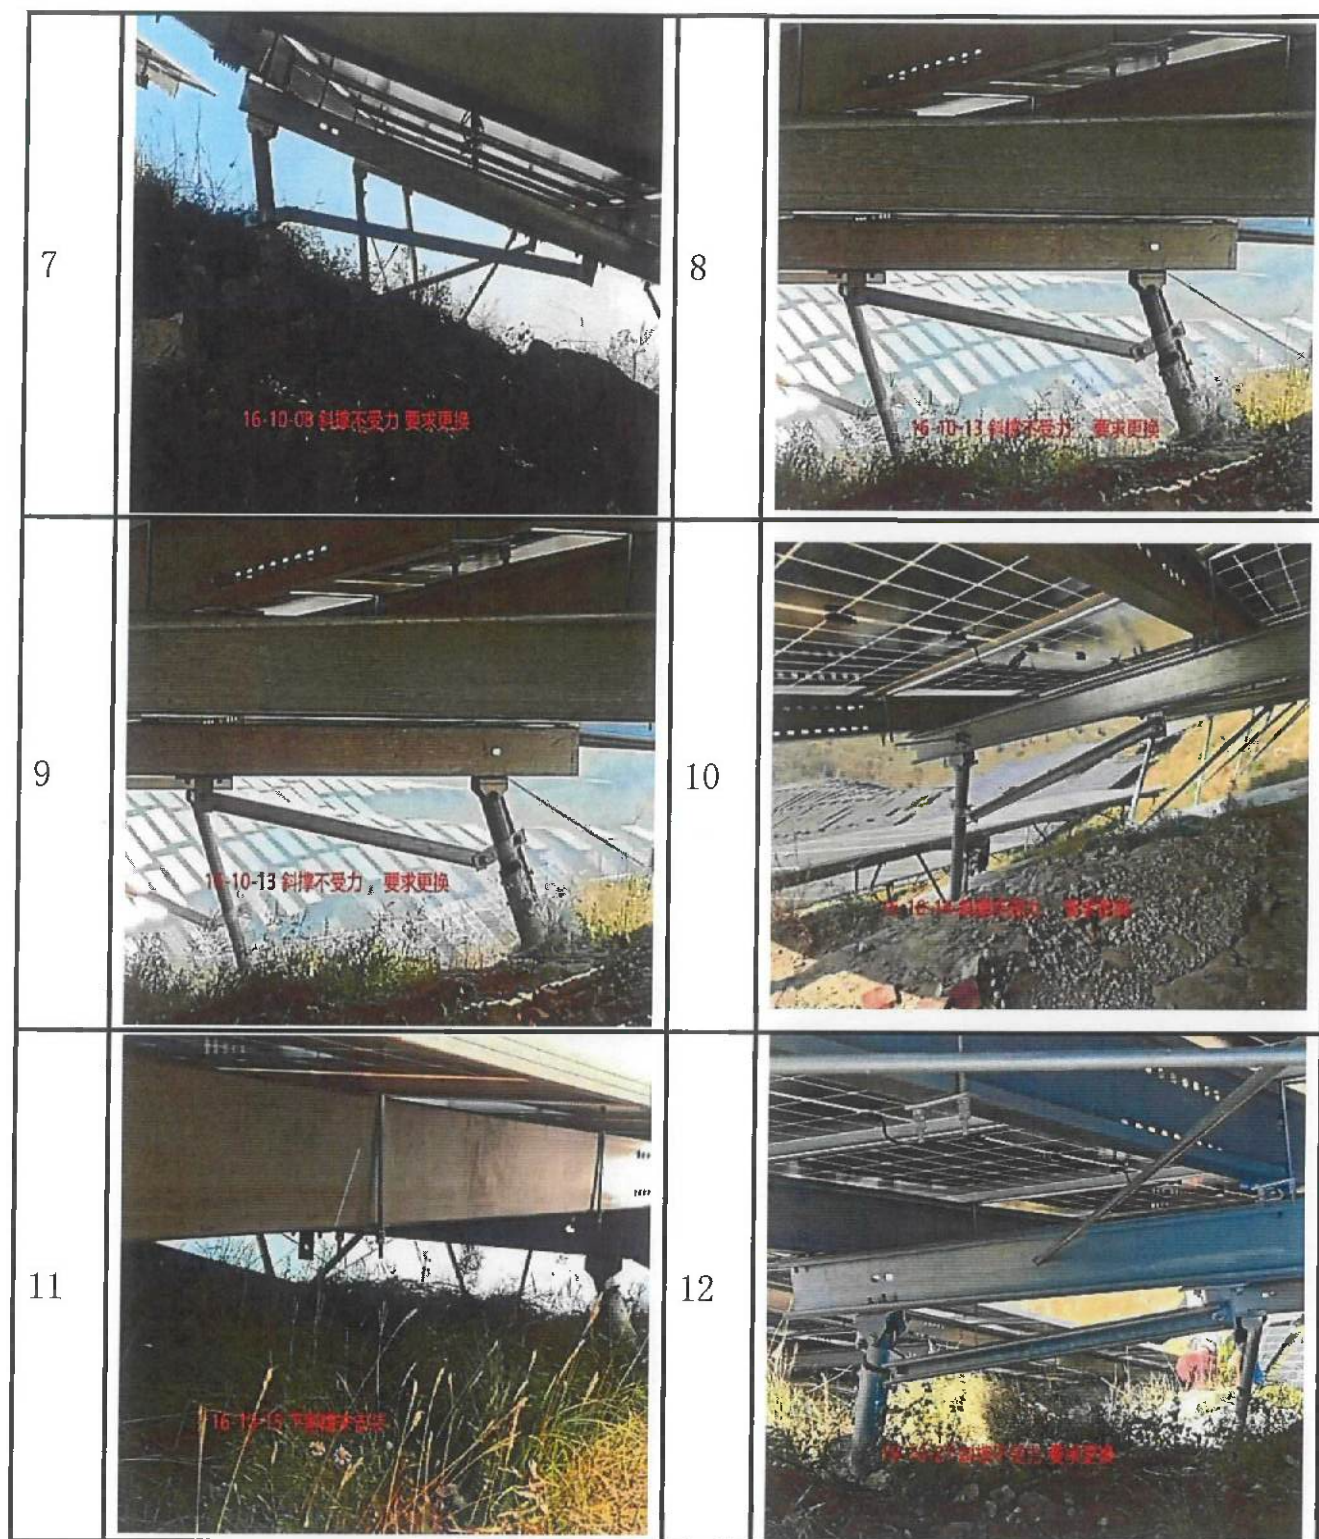

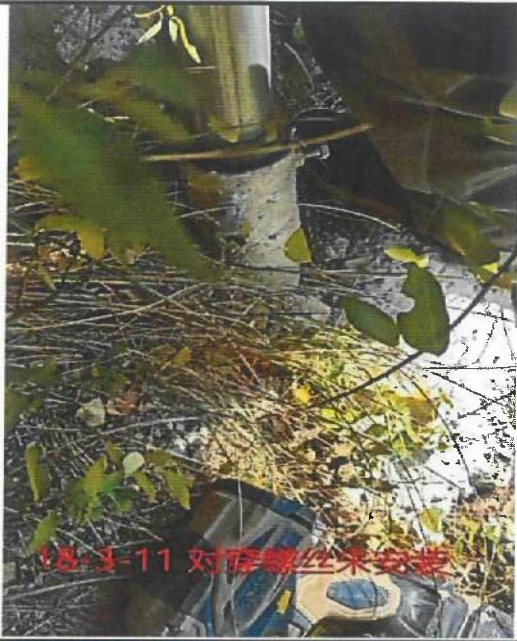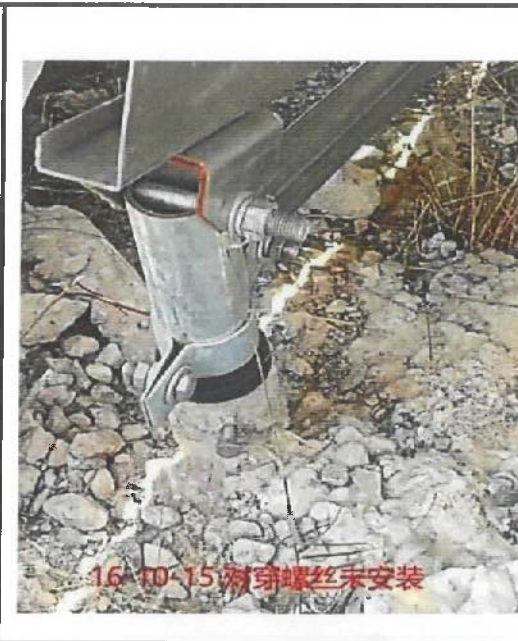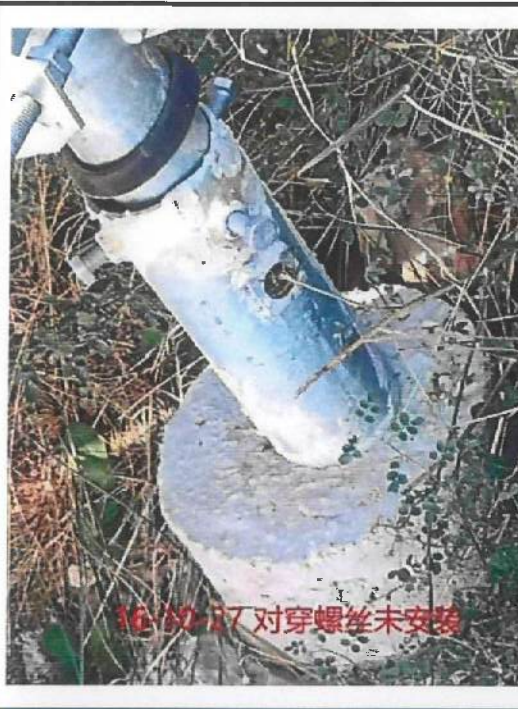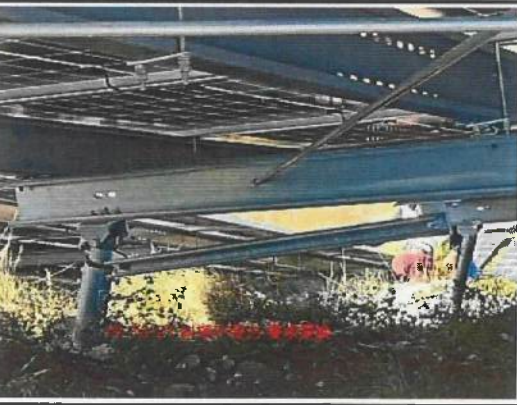13		14	
15		16	
17		18	

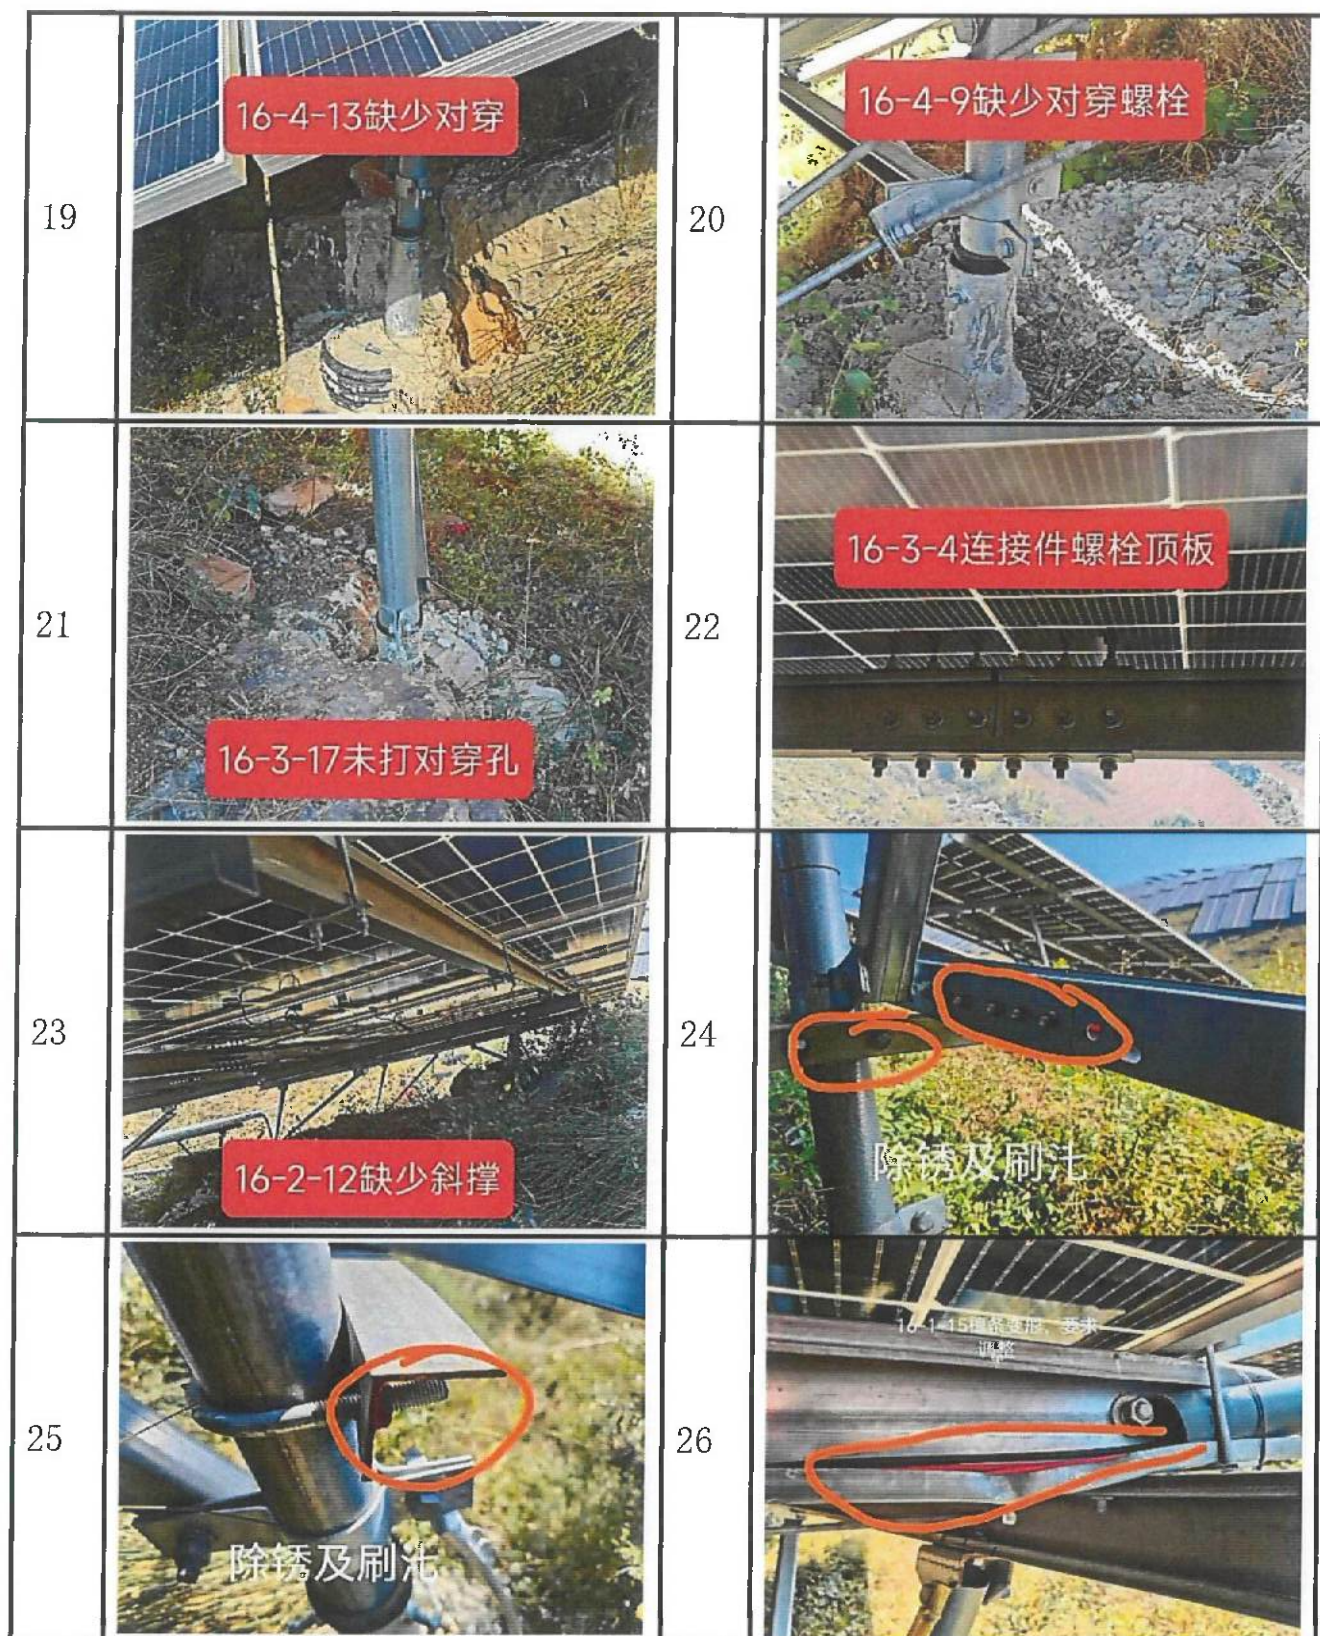

27



28



29



160627整组檩条中间有缝隙。

30



160624, 使用钢管套拉杆。


31



32




33

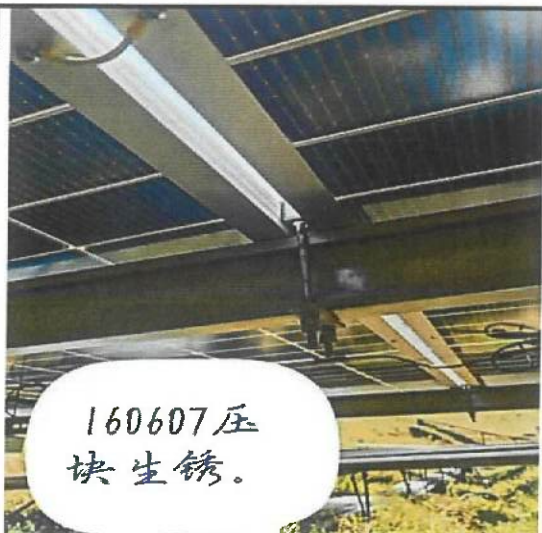

34




35

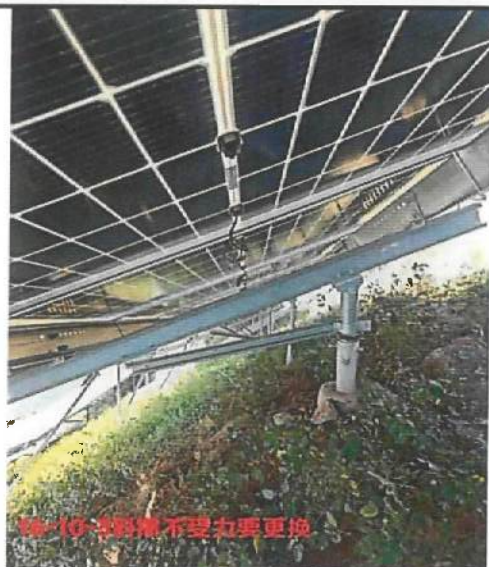


36




37

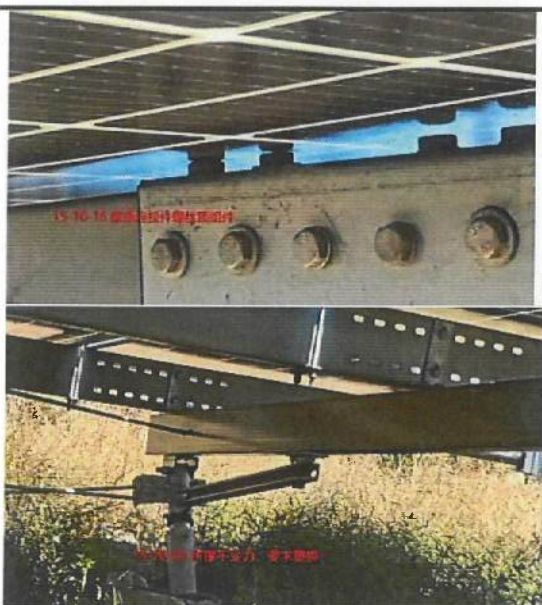

38

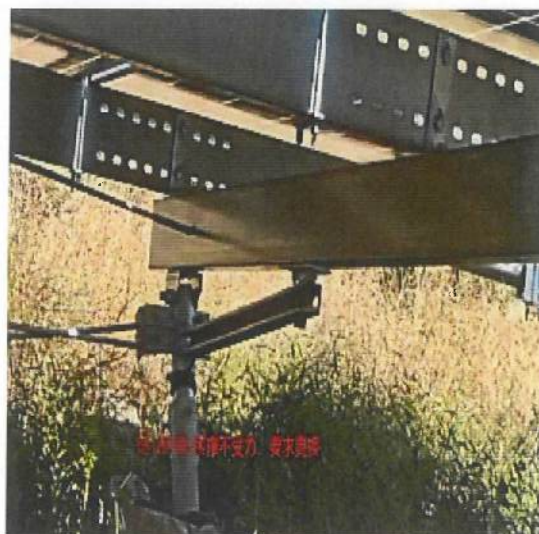

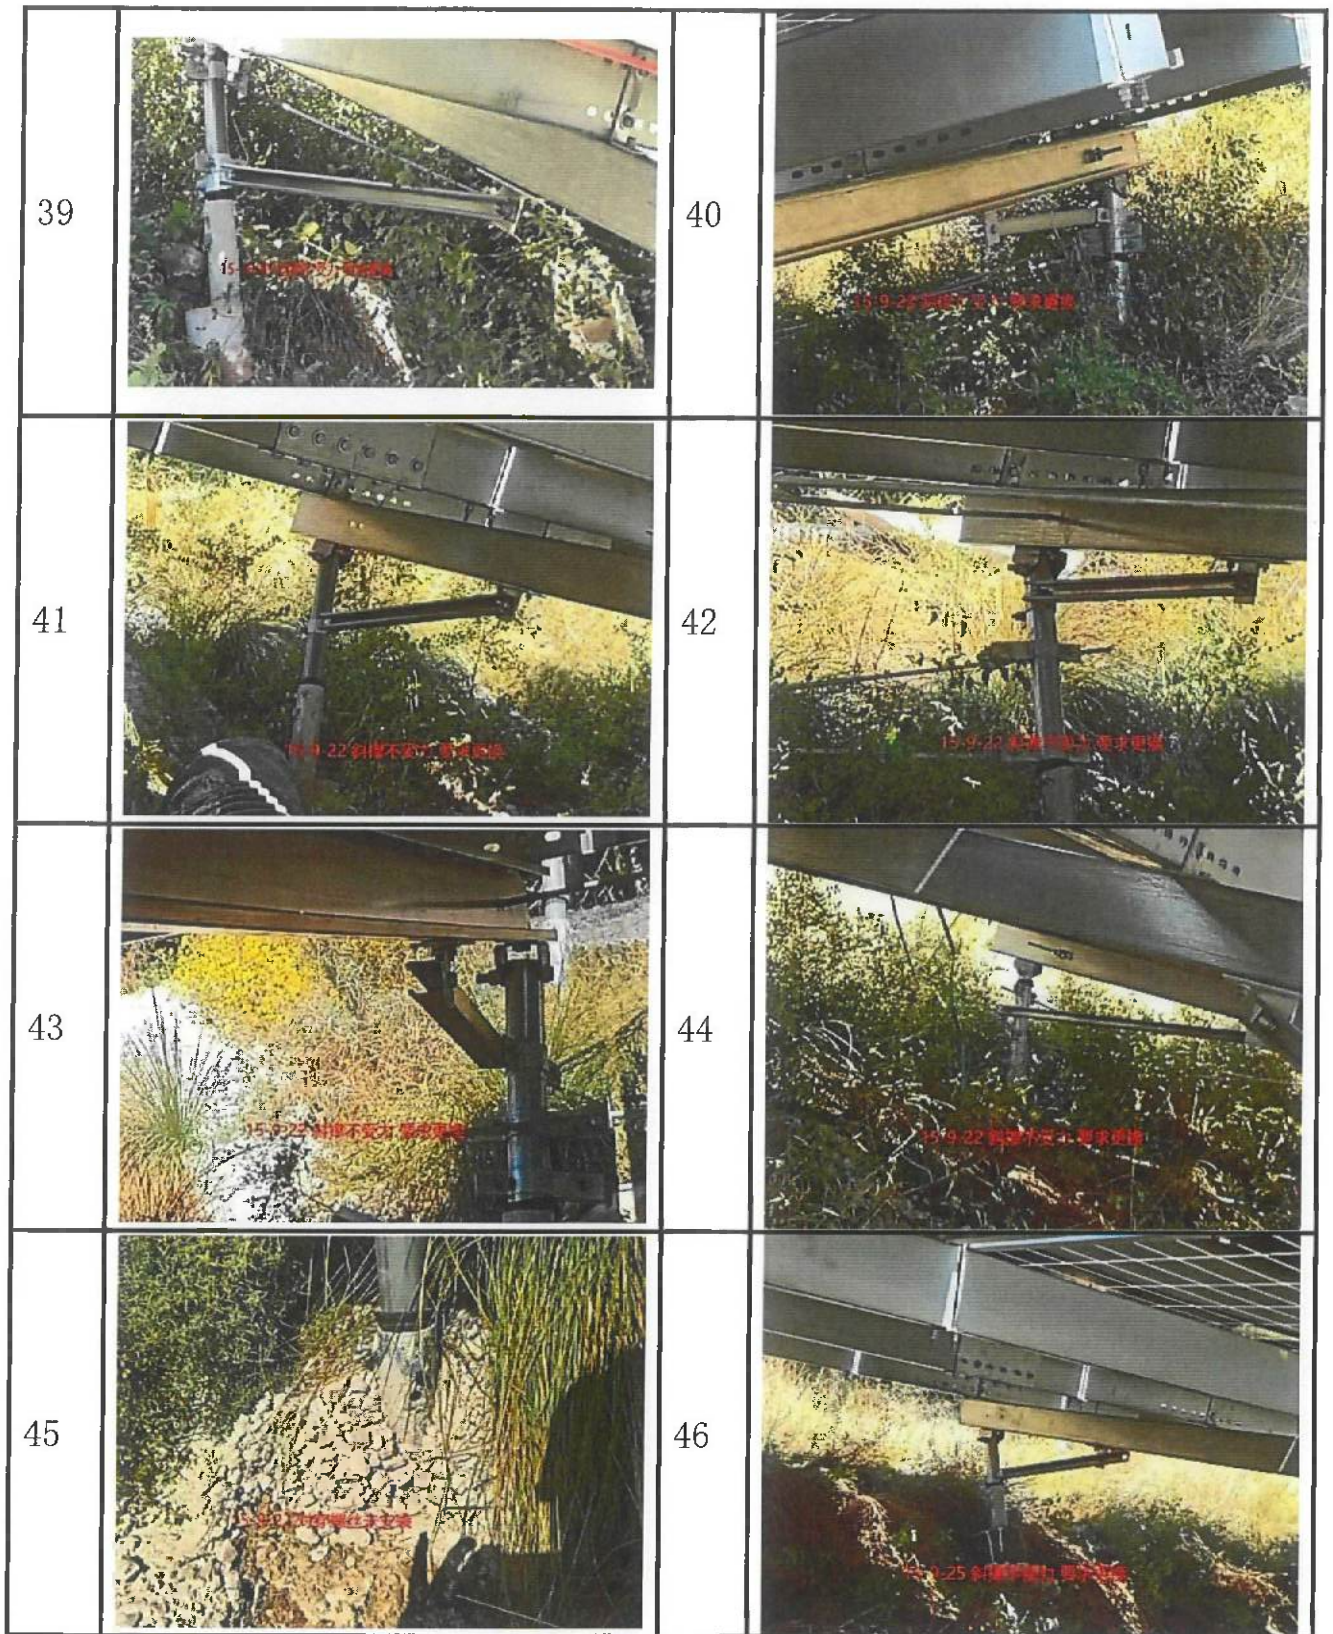


47



48



49

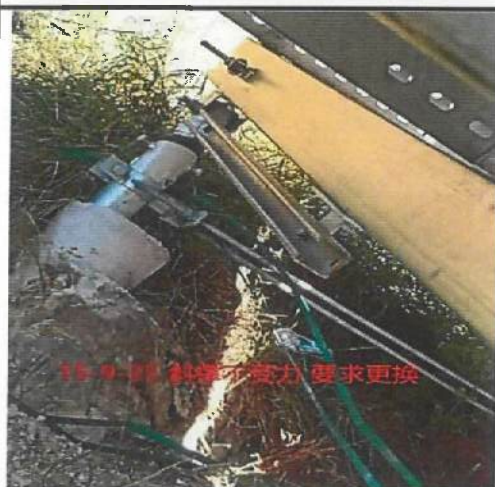


50



51



52

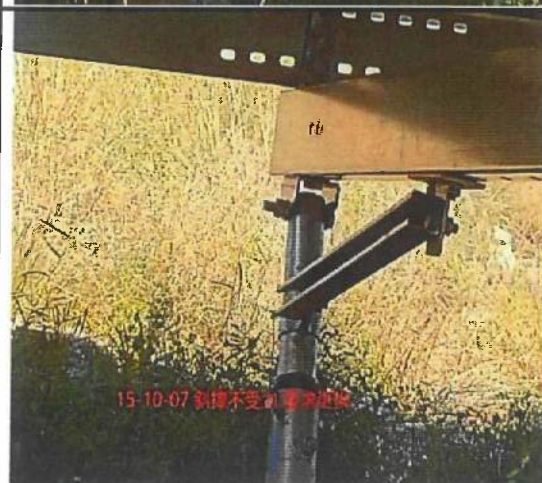


53



54





55

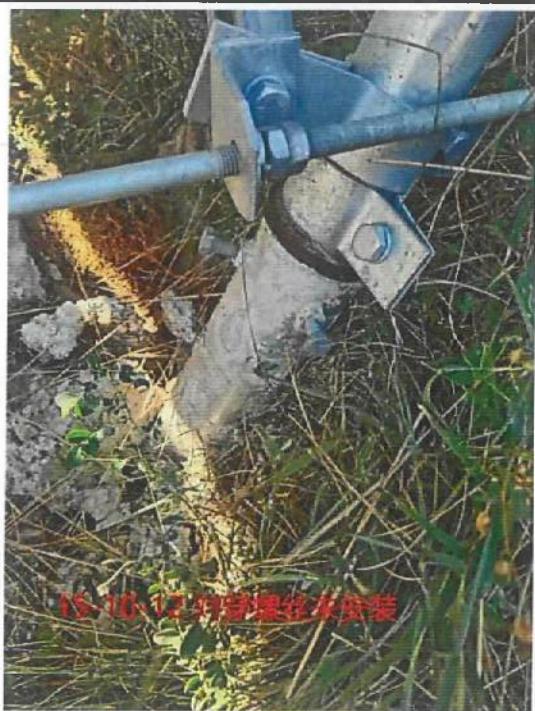

56

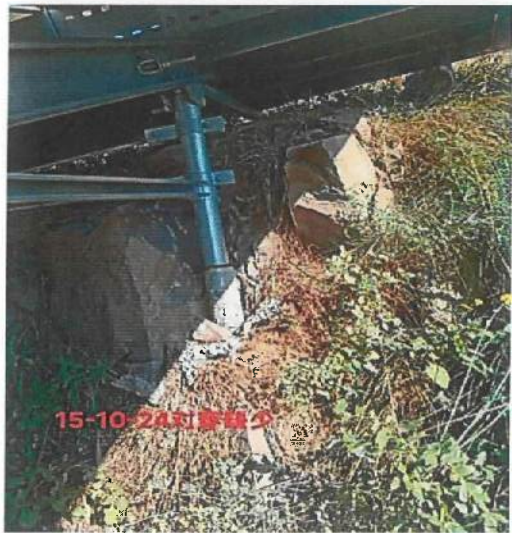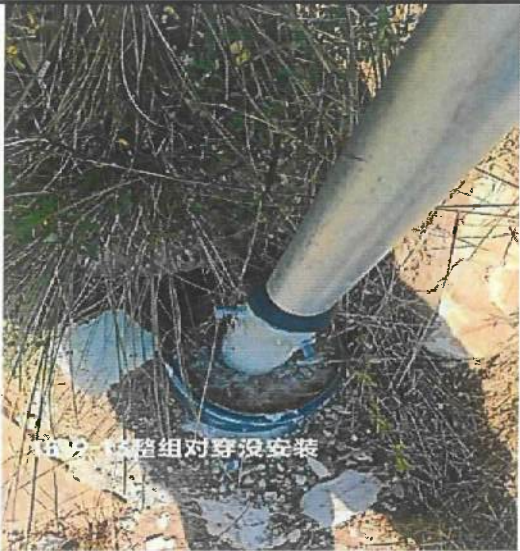

57		58	
59		60	

61	 15-2-9	62	 15-1-4未做防护封堵
63	 15-2-26缺少对穿	64	 15-3-04斜梁不够长
65	 15-08-21桩基不符合要求缺少防水处理	66	 15-08-16缺背拉杆
67	 15-08-14、15-08-20、15-09-17 15-09-18板面有水泥砂浆需清理	68	 15-08-01立柱斜支撑太短更换

69	 15-09-05缺平拉杆	70	 15-09-07接地小黄线缺失
71	 150429背拉杆u型扣缺少	72	 150403斜撑不受力。
73	 150418整组垫片生锈。	74	 1504号方阵，大量使用薄垫片的压块生锈需更换。

75



1504逆变器附近桥下螺丝生锈。

76



150328压块生锈。

77




150328下方
桥架未封堵。

78




150325
水土流失。

79

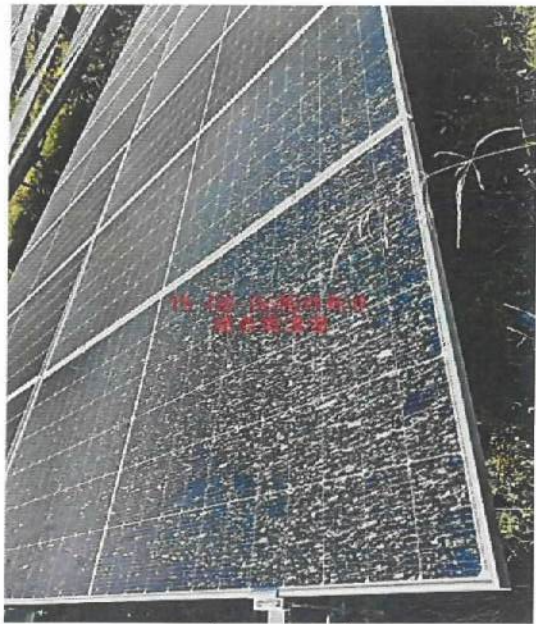


80



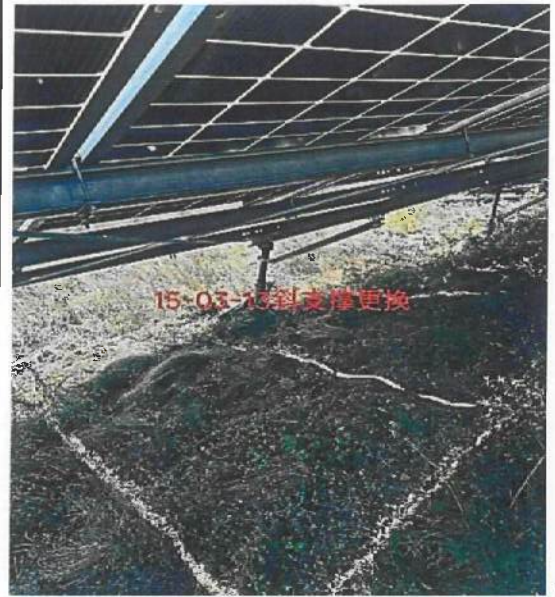


81



82

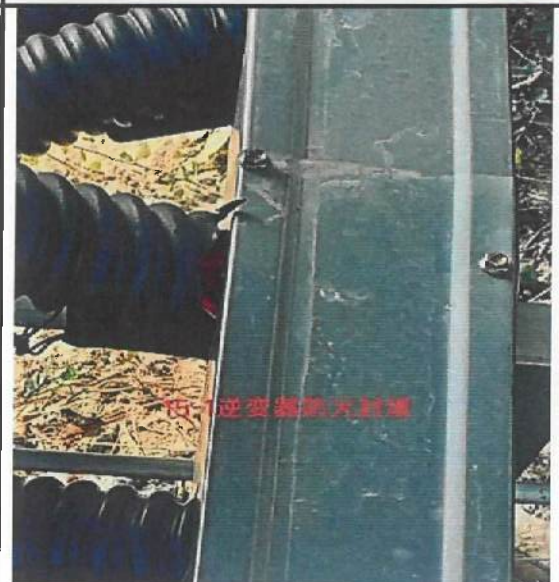

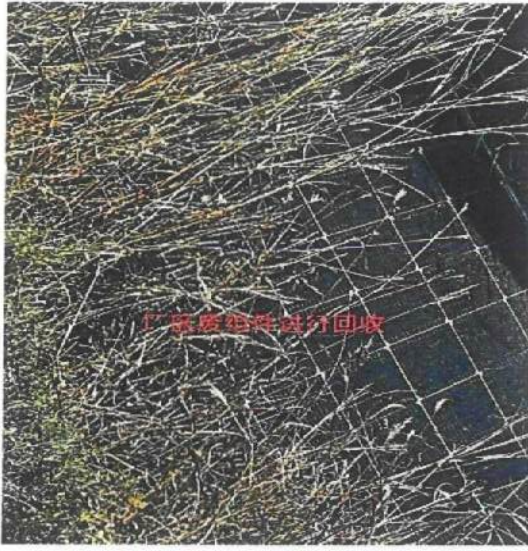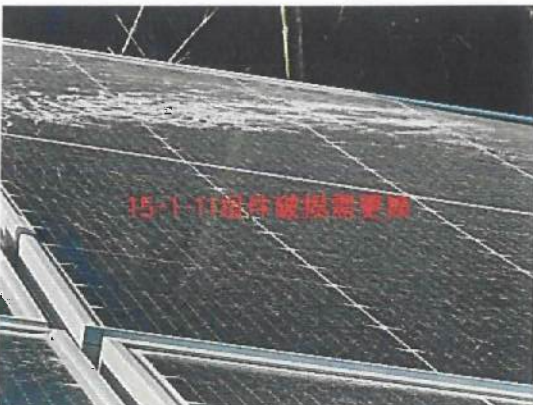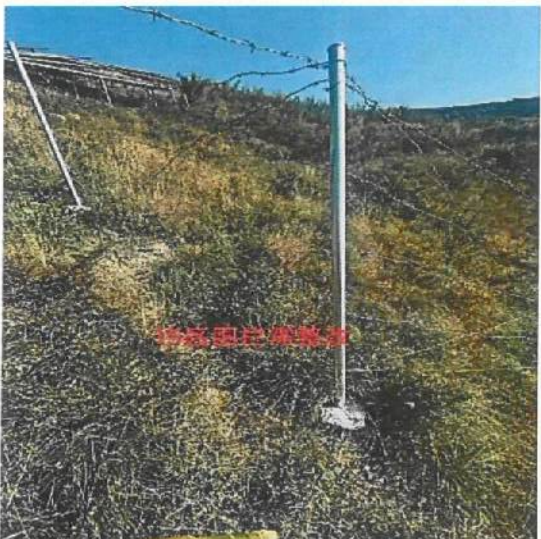83	 大量废弃件及时回收	84	 15-1-11组件破损需要更换
85	 支架螺丝生锈	86	 立柱已经倾斜
87	 140413斜撑不受力。 缺少对穿螺丝。	88	 1404片背拉杆 不受力，改 到前面去。

89



90



140415, 斜撑不受力。

91



92






93





94

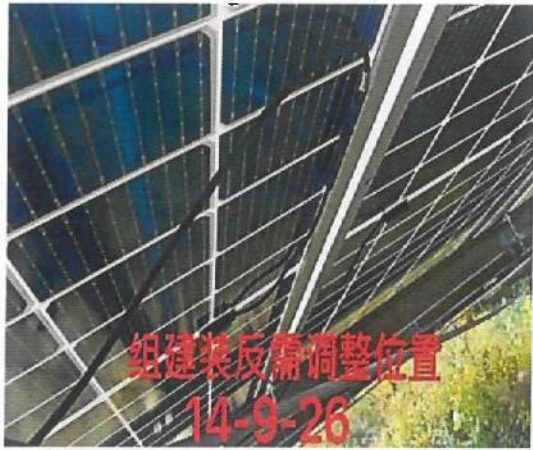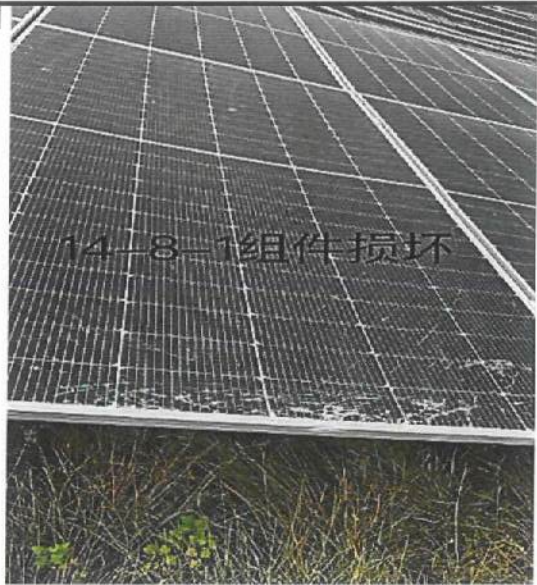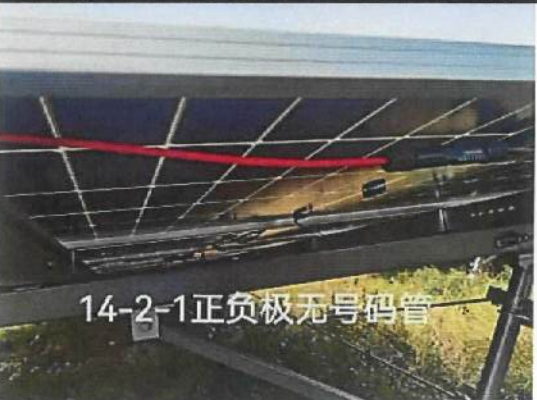

95	 组件装反需调整位置 14-9-26	96	 14-8-1组件损坏
97	 逆变器外壳接地线未与接地网直接连接	98	 14-2-23负极无号码管
99	 14-2-28斜撑需更换	100	 14-2-26斜撑需更换
101	 前后排间距, 12点左右	102	 14-2-1正负极无号码管

103	 线槽，穿管未封堵	104	 14-3-7斜撑需更换
105	 14-3-4檩条短	106	 14-3-3两横斜撑需更换
107	 14-3-20穿管口未封堵	108	 14-6-18地基缺沙

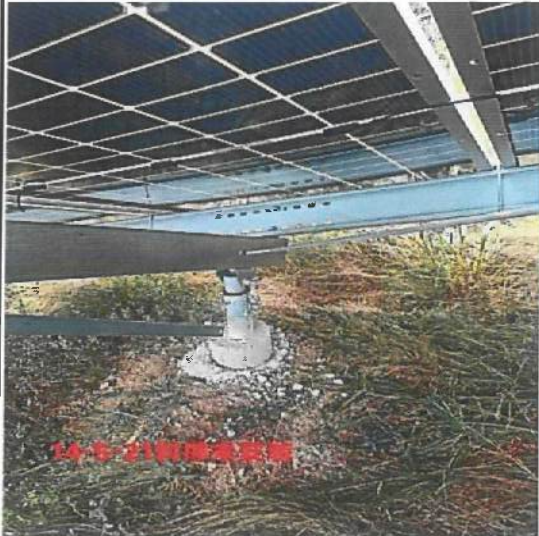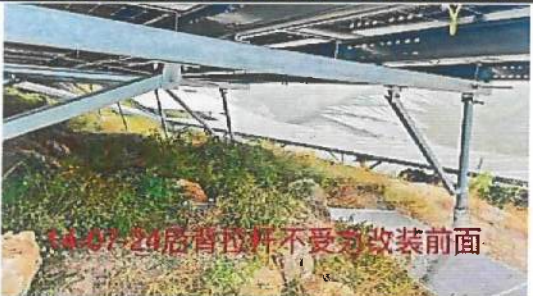
109		110	
111		112	
113		114	
115		116	

117	 14-05-03、14-05-06 檩条串位边压块不受力	118	 14-8-13缺少胶圈
119	 14-8-13缺少对穿螺栓	120	 14-8-5缺少对穿螺栓
121	 14-7-19缺少对穿螺栓	122	 14-7-19拉杆安装不规范
123	 14-7-2缺少对穿螺栓	124	 14-7-15缺少对穿螺栓

125



126

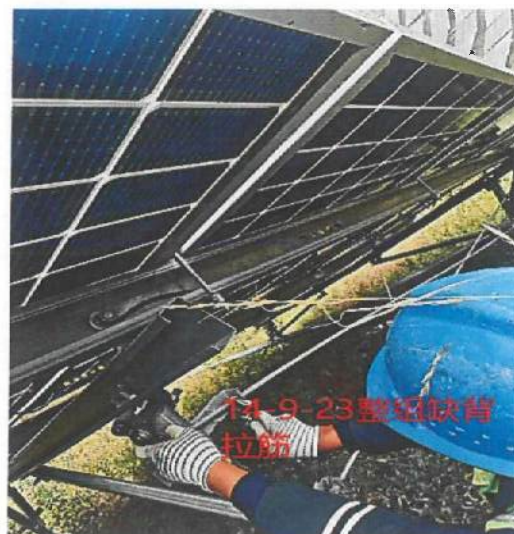

请贵单位按照上述问题立即消缺整改。

请贵单位在收到本通知后进行立即整改，限 3 个 工作日内将整改结果书面回复监理项目部。

项目监理机构（章）:

专业监理工程师:

总监理工程师:

日

期:

2014.10.16

填报说明：本表一式 2 份，由项目监理机构填写，抄送相关单位。